

06D COMPRESSORS

1) Cut the wire connecting to the Run winding (1) on the compressor, and splice the BROWN wire from the EasyStart to it.

2) Connect the BLACK wire from the EasyStart to terminal 3 of OL1.

3) Connect the ORANGE wire from the EasyStart to Start winding side of the Run capacitor.

4) Connect the WHITE wire (shown as gray) from the EasyStart to the L2 side of the Run capacitor.

5) Remove the wire connections to the Start capacitor and to the Start Relay as shown by the RED X's. You may also completely remove the Start Relay, but you must splice the Start Winding wire as shown in blue.

NOTE: THE 'R', 'S' AND 'C' THAT APPEAR ON THIS DIAGRAM ARE NOT IMPRINTED ON THE TERMINAL PLATE AND ARE SHOWN HERE FOR INFORMATION PURPOSES ONLY.

